

# Vertiv™ Avocent® RM1048P Rack Manager

## Release Notes

VERSION 1.59.4, MAY 2024

### Release Notes Section Outline

1. Update Instructions
2. Appliance Firmware Version Information
3. Features and Enhancements
4. Device Support Information
5. Language Support Information
6. Client Browser Support Information
7. Viewer Support and Version Information
8. Dashboard Support Information
9. Server Processor (SP) Support Information
10. Power Distribution Unit (PDU) Support Information
11. Rack UPS Support Information
12. TCP Port Usage Information
13. Known Issues and Limitations

### 1. Update Instructions

The Vertiv™ Avocent® RM1048P Rack Manager firmware may be updated through the web user interface (UI). To access the rack manager web UI, enter your assigned IP address into a web browser (this IP address is provided upon initial set up of the Vertiv™ Avocent® RM1048P Rack Manager).


**NOTE:** For additional information on this process, see the Vertiv™ Avocent® RM1048P Rack Manager Quick Installation Guide that is provided with the rack manager and also available at [Vertiv™ Avocent® RM1048P Rack Manager](#) under the *Documents & Downloads* tab.

**IMPORTANT NOTE:** Prior to updating the firmware, ensure your hardware will have full integration software support with this release. For more information, contact your Vertiv Technical Support representative.

To update the Vertiv™ Avocent® RM1048P Rack Manager firmware:

1. Visit the Vertiv™ Avocent® RM1048P Rack Manager firmware download page located here: [Vertiv™ Avocent® RM1048P Rack Manager Software Download](#)
2. Download the latest firmware and save it to your local computer, FTP or HTTP server.  
**NOTE: The latest firmware version is listed in the Appliance Firmware Version Information section of these release notes.**
3. In a web browser, enter **https://<appliance.IP>** using the IP address for Vrf\_app0 that you configured from the Vertiv™ Avocent® RM1048P Rack Manager console menu.
4. Enter your username and password at the login screen; the Targets List screen opens.

- In the sidebar, select *Appliance-Overview* and click the *Update Firmware* button.

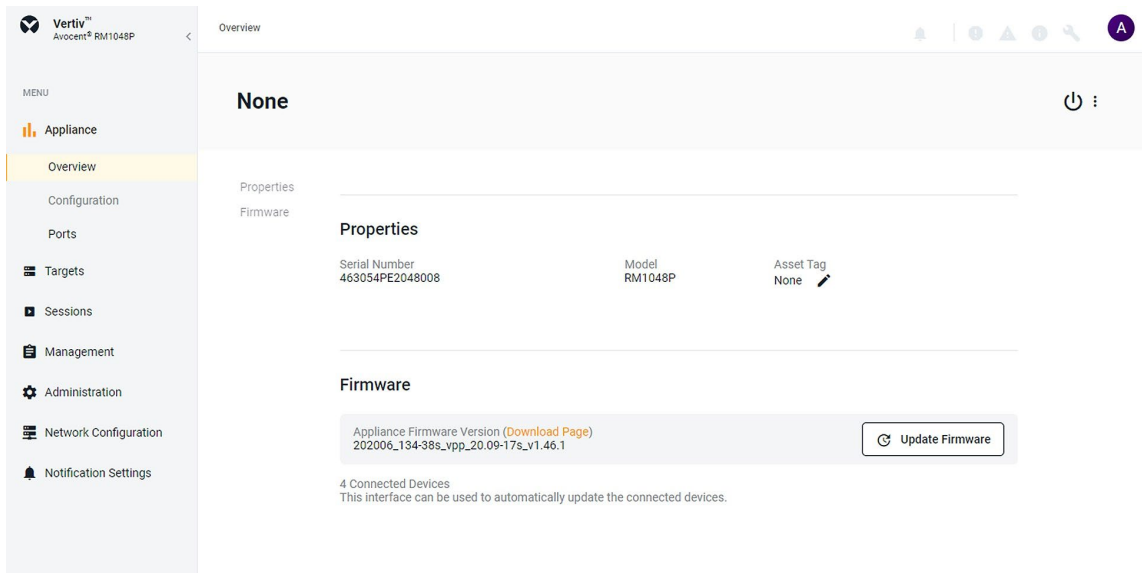

- Select if you'd like to update the firmware for just the rack manager or if you'd like to update the firmware for just the connected targets.
- Select the firmware file and click *Update*.  
**NOTE: FTP and HTTP are the only supported protocols for updating the firmware. The TFTP protocol is not supported.**

## 2. Appliance Firmware Version Information

APPLIANCE/PRODUCT	VERSION	FILENAME
Vertiv™ Avocent® RM1048P Rack Manager	1.59.4	SONiC-202006_134-40s_vpp_20.09-17s_v1.59.4.bin

## 3. Features and Enhancements

### Resolved Issues

- General issues resolved:
  - Fixed issue where existing DNS entries are being deleted and replaced with default values after performing a management platform firmware upgrade (CA-0000779993).
  - Fixed issue where a duplicate icon to launch a serial session for a merged target associated with ports on the Vertiv™ Avocent® ACS800 and/or ACS8000 advanced console systems appliance is displayed on the Targets List and Appliance View (CAS-55823-Z2HOCO).
  - Fixed issue where the certificate replacement script is unable to retrieve the certificate or generate a CSR request for the Vertiv™ Avocent® RM1048P Rack Manager appliance (CAS-56734-T6J4NO).
- Resync issues resolved:
  - Fixed issue where users were unable to resync the names of target devices connected to a Vertiv™ Avocent® MergePoint Unity™ switch managed by Vertiv™ Avocent® DSView™ 4.5 management software, which prevented target devices from launching KVM sessions.
- Resource Group issues resolved:
  - Fixed issue where adding target devices located across multiple pages to an existing resource group caused some of the devices in the resource group to be deselected and removed from the resource group.
- Web UI issues resolved:
  - Fixed issue where configuring a notification policy with a list of email addresses separated by a carriage return generates an error message.
  - Fixed issue where the user is unable to change a full name in the User Preferences view.

## 4. Device Support Information

The following devices may be managed by the Vertiv™ Avocent® RM1048P Rack Manager:

- Vertiv™ Avocent® IPUHD 4K IP KVM device
  - Vertiv™ Avocent® IPIQ IP KVM device
  - Vertiv™ Avocent® IPSL IP serial device
  - Vertiv™ Geist™ rPDUs
  - Vertiv™ Liebert® rack UPS devices
  - Vertiv™ Avocent® Universal Management Gateway appliance UMIQ-v2 module converted to operate as a Vertiv™ Avocent® IPIQ IP KVM device
- NOTE: For this functionality, contact your Vertiv Technical Support representative.**

## 5. Language Support Information

The Vertiv™ Avocent® RM1048P Rack Manager software currently supports English and Simplified Chinese.

## 6. Client Browser Support Information

**NOTE: Unless noted otherwise, both 32-bit and 64-bit browsers are supported.**

BROWSER	PREFERRED VERSION	SUPPORTED VERSIONS
Edge	115+	79+
Firefox (Windows, MacOS, Linux)	115+	35+
Chrome	115+	40+
Safari	16+	12+

## 7. Viewer Support and Version Information

### Supported Viewers

VIEWER	VERSION
KVM Viewer	4.31.1
Serial Viewer	4.13.1

## 8. Dashboard Support Information

ITEM	VERSION
Dashboard	1.29.1

## 9. Server Processor (SP) Support Information

### Tested SPs/Servers and Firmware

NOTE: Other SPs that support IPMI 2.0 may also be supported.

SERVICE PROCESSOR	FIRMWARE VERSION	PROTOCOLS
Dell iDRAC6 (R)	2.92	IPMI 2.0
Dell iDRAC7	2.65.65.65	Redfish, IPMI 2.0
Dell iDRAC8	2.84.84.84	Redfish, IPMI 2.0
Dell iDRAC9	6.10.80.00	Redfish, IPMI 2.0
HP iLO 2	iLO 2 v2.33	IPMI 2.0
HP iLO 3	iLO 3 v1.92	IPMI 2.0
HP iLO 4	iLO 4 v2.82	Redfish, IPMI 2.0
HP iLO 5	iLO 5 v2.91	Redfish, IPMI 2.0
Lenovo IMM2	TCOO60A 5.90	IPMI 2.0
Lenovo XCC	CDI3A8N 9.40	Redfish, IPMI 2.0
FSC iRMCS4	9.62F	IPMI 2.0
ACI	v4.3-2022-r08	Redfish, IPMI 2.0
OpenBMC	2.9, 2.11	Redfish, IPMI 2.0

### Supported SPs/Servers for Launching KVM Sessions

SERVICE PROCESSOR	PORT	PORT TRAFFIC
Dell iDRAC7	5900	Inbound
Dell iDRAC8	5900	Inbound
Dell iDRAC9	5900 (default), 443 (configured with racadm)	Inbound
HP iLO 4	5900 (firmware < 2.8), 443 (firmware > 2.8)	Inbound
HP iLO 5	443	Inbound
XCC	3900	Inbound

## 10. Power Distribution Unit (PDU) Support Information

PRODUCT FAMILY	FIRMWARE VERSION
Vertiv™ Geist™ I-03 PDU	5.10.4

## 11. Rack UPS Support Information

### SUPPORTED VERTIV RACK UPS PRODUCT

Vertiv™ Liebert® GXT4 and GXT5 UPS

Vertiv™ Liebert® PSI5 UPS

Vertiv™ Edge UPS

Vertiv™ Liebert® APS UPS

## 12. TCP Port Usage Information

PORT	TYPE	PORT TRAFFIC	DESCRIPTION
443	TCP	Inbound, Outbound	General Communications (TCP)
22	TCP	Inbound	General Communications (TCP)
3871	TCP	Outbound	Vertiv™ Avocent® ACS800/8000 advanced console systems

## 13. Known Issues and Limitations

This release contains the following known issues and limitations:

- SP issues:
  - Users are unable to access the web UI for iDRAC 8/9 service processors with firmware version 5.10.50.00 or higher from the Target List view. To resolve this issue:
    1. Log in to the iDRAC 8/9 service processor from a console window.
    2. Execute the **racadm get idrac.webserver.HostHeaderCheck** command and verify the host header check is enabled.
    3. Execute the **racadm set idrac.webserver.HostHeaderCheck 0** command and verify it is successfully executed.
    4. Execute the **racadm get idrac.webserver.HostHeaderCheck** command and verify the host header check is disabled.
    5. Launch the web UI for the iDRAC 8/9 service processor from the Target List view. Accessing details for SPs that were discovered using invalid Credential Profile information results in an error message and no device details are shown. The workaround for this is to update the Credential Profile in the SP's Properties panel and perform a Resync operation, or you can rediscover one or more SPs with an IP Range Discovery operation using the correct Credential Profile(s).
  - OpenBMC SPs do not support virtual media, sensor, power or thermal data.
  - Virtual media resources are not supported in the XCC SP.
  - Mounting virtual media on iDRAC7/8 SPs behaves inconsistently.
  - CIFS and NFS are not operational for HP iLO4 and iLO5 SPs.
  - Unable to add an HP iLO4 device that is configured with a 1-1 NAT rule to the Vertiv™ Avocent® MP1000 Management Platform.
  - No access is given to archived events on an HP iLO5 SP.
  - Retrieving metric information from service processors may fail within a specific period of time (for example, 30 minutes) after an initial request to obtain metric information has been initiated.
  - The default system roles (User-Role, User-Administrator-Role and System-Maintainer-Role) do not include access to SPs.
- Session/Viewer issues:
  - Unable to map files or folders in Virtual Media using the Firefox client browser. This feature is only supported by Chrome and Edge client browsers.

- The icon to launch viewer sessions at the row level of the Appliance and Target List Views is missing for serial target devices that are managed by the Vertiv™ Avocent® DSView™ management software and displayed on the Management Platform web UI. The icon to launch viewer sessions is available on the Properties side panel.
- Renaming a target device that is managed by the Vertiv™ Avocent® DSView™ management software and displayed on the management platform web UI prevents launching a viewer session to the target device.
- After the initial discovery of a Vertiv™ Avocent® IPIQ IP KVM device, the launch KVM icon in the Targets List and Appliance View remains disabled until the device completes the registration process. The Targets List View page can be refreshed after a few minutes to access the launch KVM icon for the device.
- VM sessions are not cleared after exiting the KVM Viewer.
- A KVM session to a Vertiv™ Avocent® IPUHD 4K IP KVM device that goes into sleep mode due to user inactivity does not respond to keyboard or mouse input.
- Session timeout modifications do not take effect until a logout occurs; no message is forthcoming.
- Viewer sessions for a Vertiv™ Avocent® IPUHD 4K IP KVM device connected to a Vertiv™ Avocent® RM1048P Rack Manager does not show up correctly in the Dashboard.
- Web UI issues:
  - When attempting to delete a list of users that includes the default system administrator user, none of the selected users are deleted from the system.
  - The scroll bar on the Target List view is hidden when the browser window is resized to a smaller size.
  - Clicking away from the Device Properties panel before the properties are fully loaded generates several errors for Vertiv™ Avocent® IPSL IP serial devices and the Vertiv™ Avocent® IPUHD 4K IP KVM devices.
  - The RS422 and RS485 RJ-45 pin-out value options on the Physical Port Settings panel only apply to ports 1 and 2 of the Vertiv™ Avocent® ACS8000 advanced console system.
  - On the Organizations page, the Launch KVM Session icon may overlap with the Device Status icon. To resolve this issue and properly align both icons, zoom out on the browser page.
  - Creating a new organization or filtering devices on organizations without any devices occasionally generates an error message; however, the new organization is successfully created.
- General issues:
  - Upgrading the Vertiv™ Avocent® RM1048P Rack Manager appliance may display the upgrade status “In Progress” for a long period of time even after the upgrade has completed successfully. When this occurs, manually reboot the rack manager appliance.
  - A power cycle of a Vertiv™ Liebert® rack UPS device outlet group using the web UI does not work properly when the outlet group is already turned off.
  - The outlet groups of a Vertiv™ Liebert® rack UPS device that is connected to a Vertiv™ Avocent® RM1048P Rack Manager may not be synchronized in the Appliance View or Target List page after an appliance firmware upgrade. To resolve this issue, delete the UPS device and add it back to the Appliance View or Target List page.
  - Unable to discover a Vertiv™ Geist™ rPDU device with firmware 6.x using a credential profile that is configured with username and password. To resolve this issue, enable the Aggregation feature and set the HTTP Interface to “Enabled” on the rPDU device. Then, re-discover the rPDU device using the web UI.
  - Unable to discover a Vertiv™ Geist™ rPDU device with a Credential Profile that is configured with a specific port number. To resolve this issue, leave the port field blank and re-discover the rPDU device.
  - Changing the assigned DHCP IP address of a Vertiv™ Geist™ rPDU device to a reserved IP address causes the status of the device to show incorrectly. To resolve this issue, delete the Vertiv™ Geist™ rPDU device from the web UI and rediscover the device using the reserved IP address.
  - The Credential Profile assigned to a target device cannot be modified after the target device is discovered and added to the Target List page. To modify the Credential Profile, you need to rediscover the target device.
  - The Appliance View may show duplicate entries for Vertiv™ Geist™ rPDUs after discovery of rPDUs with the following Credential Profile Configurations:
    - If there is one Credential Profile configured with SNMP V2 and firmware update credentials.
    - or-
    - If there are two Credential Profiles where the first Profile is configured with SNMP V2 and the second is configured with username/password.

If this situation occurs and an rPDU listing is duplicated in the Appliance View, the rPDU power outlet status will not display correctly. To resolve the duplicate entry scenario, delete one of the duplicate listings. Once the duplicate listing is deleted, wait a few minutes and refresh the web page. This should then correct the rPDU power outlet status information as well.

- The scheduled Daily Alarm Purge operation only purges alarms that are cleared and older than the configured retention period.
- The alarm drop-down list in the upper right corner of the page does not update correctly when new alarms are generated. To resolve this issue, log out and log back into the application to view the updated list of alarms in the drop-down list.
- Device name synchronization is not available for Vertiv™ Geist™ rPDUs discovered via SNMP.
- Unable to change the power state of a Vertiv™ Liebert® PS15 UPS outlet group.
- An attempt to establish a remote Virtual Media session to a Vertiv™ Avocent® IPUHD 4K IP KVM device managed by a Vertiv™ Avocent® RM1048P Rack Manager using the NFS Transfer Protocol fails with an error message.
- Changing network settings from DHCP to Static on the Properties panel requires you to wait at least one minute, then refresh the page to view updated changes.
- The Kingston USB device is not supported and not displayed in the Boot Manager.
- Power Control is non-functional for unlicensed VMWare targets.
- The Virtual Machine Viewer Caps Lock (and other keys) are not highlighting when using Linux; this is not supported in VMWare.
- The changed time (from the CLI) is not maintained through a reset. BIOS overrides time and must be set via BIOS.
- Deleting an unmanaged Vertiv™ Avocent® RM1048P Rack Manager in the Vertiv™ Avocent® MP1000 Management Platform does not trigger the rack manager to go into Standalone mode; it must be done manually.
- In some rare cases, the Status column in the Target List view disappears using the Chrome browser. If this occurs, clear the browser cache and open a new browser window.